Revision No. 2	Page 1 of 4		
p	tp.	Technical Definition In Plane Shear	
Kit In Plane Shear PTP 2021		Carbon Fiber Composite	

You shall respect the HSE policy of your laboratory for each performed test.

Instructions to participant laboratories

Please read carefully these instructions BEFORE starting the tests.

1. Five specimens (250 x 25 x 1,44 mm) are supplied to each participant – 5 results must be provided.

If one result is missing, your test will be considered as an outlier. A RCA shall be completed.

- 2. The specimens have to be dried during 48 hours (0/+10) at 70°C (+/- 3) and tested within the next 8 hours after the drying.
- 3. All tests have to be performed at room temperature in accordance with the requirements of **ISO 14129 (1997)**.

(This test kit has to be performed according to ISO standard but the participation will also covers the In Plane Shear method according to AITM 1-0002 issue 3.)

The tests shall be performed respecting the following conditions:

- One operator only
- One testing machine only
- Tests performed in sequence
- 4. The following information need to be reported:

Characteristic		Significant digits	Mandatory / Not mandatory	Evaluated Yes/no
Specimen thickness	mm	X,XX	Mandatory	No
Specimen width	mm	X,XX	Mandatory	No
Shear Modulus G calculated between 0,001 and 0,005 shear strain	GPa	XX,XX	Mandatory	Yes
Shear Strength at shear strain 5% - $[\tau_{5\%}]$	MPa	XXX,X	Mandatory	Yes
Shear Strength at maximum load - $[\tau_{max}]$	MPa	XXX,X	Mandatory	Yes
Shear Strength at 0,2% offset - $[\tau_{0,2\%}]$	MPa	XXX,X	Mandatory	Yes
Failure mode	N/A	N/A	Mandatory	No
Upload of the official test report	N/A	N/A	Mandatory	No

All evaluated characteristics will be analysed according to the algorithm A and S (ISO 13528 – 2015) and evaluated using z-score.

5. Testing shall start **as soon as test specimens are received**. Please contact the following e-mail address for any technical or administrative query.


Submission date :	July 30 th , 2021	
Technical and administrative support :	info@ptpscheme.com	

Revision No. 2	Page 2 of 4		
ptp.		Technical Definition In Plane Shear	
	e Shear PTP)21	Carbon Fiber Composite	

6. Instructions for submission of results are detailed on the website:

https://ptpscheme.com/

- 7. To ensure the confidential treatment of your results in the final report, you will be allocated a unique identity number when you register for the program.
- 8. Collusion and falsification of your PTP results are totally forbidden. In case of identification or suspicion of collusion or falsification, the laboratory will be excluded from the program and the sponsors will be immediately informed. The sponsors could ask you proofs of your records and analyses, so be sure to conserve data, curves and specimens.
- 9. The tested specimens do not need to be sent back to PTP.

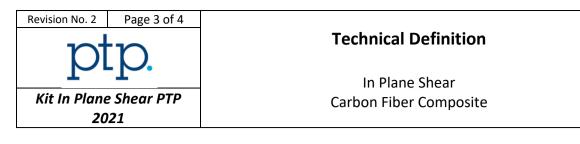

Annex

Longitudinal Modulus

The longitudinal modulus is the slope of the straight line in a longitudinal stress/strain (σ /E0) diagram through the points corresponding to two longitudinal strain values. Unless otherwise defined these longitudinal strain shall be (E0)1 = 500 x10-6 and (E0)1 = 2500 x10-6 (see figure).

Offset Shear Strength

The offset shear strength value is the shear stress value necessary to obtain a permanent longitudinal deformation (offset). Unless otherwise defined the offset value shall be 0,2% of longitudinal strain $[(\xi_0)_1 = 2000 \times 10^{-6}]$.


Longitudinal Modulus

$$E_0 = \frac{\Delta P}{wt\Delta\varepsilon_0}$$

$$\Delta \varepsilon_0 = 2000 \times 10^{-6}$$

$$\Delta P = P_{(\varepsilon_0 = 2500)} - P_{(\varepsilon_0 = 500)}$$



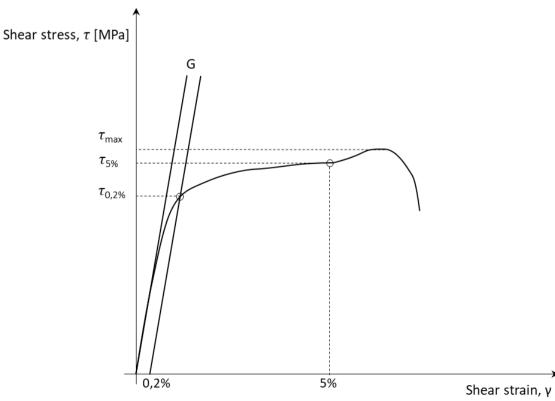

Revision No. 2	Page 4 of 4		
ptp.		Technical Definition In Plane Shear	
	e Shear PTP 121	Carbon Fiber Composite	

APPENDIX : Instructions for IRR participation

The Internal Round Robin participation (IRR) is **optional** and **independent** from your PTP participation. <u>Confidentiality</u> : The IRR results and reports are confidential and only accessible by your laboratory. They are not shared with the scheme sponsors or any other accreditation or certification bodies.

The extra samples shall be tested according to the following table:

	Operator 1	Operator 2	Operator 3	Operator 4	Operator X
Test machine	PTP kit (5	3 samples	3 samples	3 samples	3 samples
1	samples)	5 samples			
Test machine	3 samples				
2					
Test machine	3 samples				
3					
Test machine	3 samples				
Y					

Operator 1 (OP1) is to be the most experienced operator currently conducting tests on a regular basis and shall perform tests on all machines (TM1, TM2, TM3...)

Test Machine 1 (TM 1) is to be the most utilised machine for this test in your laboratory and shall be tested by all operators (OP1, OP2, OP3...)

Example: A laboratory has 2 operators and 3 test machines. They receive a PTP kit and 9 extra specimens.

Operator 1 shall test the PTP kit on TM1, 3 specimens on TM2 and 3 specimens on TM3. Operator 2 shall test 3 specimens on TM1.

The IRR results have to be submitted on a separate results form available on the PTP website. The identification of operators and test machines you provide will appear on the IRR final report. These identifications will not be seen by other laboratories.

The IRR results will be classified against the acceptance classes of the kit In Plane Shear-2021.

<u>Reminder</u>: Laboratories are not permitted to switch specimens between the PTP kit and IRR samples. The traceability of the samples will be checked during the evaluation. Laboratories found to have switched samples will invalidate their PTP participation.

REVISION HISTORY

Issue Date	Issue N°	Changes	
16/04/2021	1	Document creation	
01/06/2021	2	Results deadline extension	